# Flexco® Bolt Solid Plate Fastening System

# The Cement Industry Standard for Strong, Long-Lasting Splices

Downtime can cost a cement plant as much as \$25,000 an hour, so operators need to replace belts and get damaged belts up and running as quickly as possible. Flexco® Bolt Solid Plate fasteners are engineered to meet the demands of the toughest material handling applications, providing a strong, sift-free splice with superior holding ability. A choice of sizes accommodates belts from 3/16" (5 mm) to over 15/16" (24 mm) thick.



Exclusive Piloted Bolts: Tapered tips that cradle nuts securely in place. Reduce installation time. Easy to use.

Selection Guide								
Fastener Size	Belt Thio Ran		Mech Fastener	ts with anical Ratings To:	Minimum Pulley Diameter			
	in.	mm	P.I.W.	kN/m	in.	mm		
1	3/16 - 7/16	5 - 11	150	30	12	300		
140, 140VP	3/16 - 7/16	5 - 11	225	40	14	360		
190, 190VP	5/16 - 9/16	8 - 14	375	65	18	460		
1-1/2	7/16 - 11/16	11 - 17	300	50	18	460		
2, 2VP	9/16 - 13/16	14 - 21	440	75	30	760		
2*	15/16 - 1-1/4	8 - 32	700	123	20	510		
2-1/4	9/16 - 1-3/16	14 - 30	620	105	36	920		
2-1/2	3/4 - 1	19 - 25	450	75	42	1070		
3	15/16 & over	24 & over	560	100	48	1220		

<sup>\*</sup> When used with No. 3 Lead Wedlok® pattern, belts over 7/8" (22 mm) require extra long No. 2-1/4 bolts



#### High strength.

High strength is the result of superior design and plate compression on both the top and bottom sides of the belt. High tensile strength bolts compress top and bottom plates to distribute splice tension evenly across the entire width of each fastener plate. For added strength and pull-out resistance, specially formed teeth penetrate deep into the belt carcass – without damaging carcass fibers.

### Easy installation.

Field-proven templets, punches, and boring tools make it easy to quickly and accurately prepare belts for fastener installation. Fasteners are easily installed on-site using portable hand tools or power tools. Our exclusive piloted bolts also contribute to faster installation.



### FLEXCO® BOLT SOLID PLATE

### Fastening System

# **Fasteners**

Each Quick-Fit "E" box contains 25 complete fastener sets. A set consists of a top plate, a bottom plate, two nuts, and two bolts.

Ordering Information									
Steel	Stainless – 300 Series	MegAlloy® Top Plates Balance Steel MegAlloy® Top & Bottom Plates, Steel, Bolts & Nuts		Everdur					
		"E" Box (25 Fasten	er Sets)						
1E									
140E	140ES	140EMA	140EMAP	140EE					
190E	190ES	190EMA	190EMAP	190EE					
1-1/2E	1-1/2ES	1-1/2EMA	1-1/2EMAP	1-1/2EE					
2E	2ES	2EMA	2EMAP	2EE					
2-1/4E	2-1/4ES	2-1/4EMA	2-1/4EMAP	2-1/4EE					
2-1/2*									
3*									
"C"	Bucket (100 Fa	stener Sets – Botto	om Plates Pre-Assem	nbeled)					
1C		ICMA							
140C		140CMA	140CMAP	140CE					
190C		190CMA	190CMAP	190CE					
1-1/2C		1-1/2CMA	1-1/2CMAP						
2C		2CMA	2CMAP						
2- 1/4C		2-1/4CMA							
2-1/2C**									
3**									





Flexco <sup>®</sup> VP <sup>™</sup> Fasteners								
	overed Top lance Stee			Rubber Covered Top Plates MegAlloy® Bottom Plates				
Ordering Number	Plates Per Strip	Strips Per Box		Ordering Number	Plates Per Strip	Strips Per Box		
	Box*			Box*				
140VP	6	5		140VPMA	6	5		
190VP	6	5		190VPMA	6	5		
2VP	4	6						
	Bucket				Bucket			
140VPB	6	16		140VPBMA	6	16		
190VPB	6	16		190VPBMA	6	16		
2VPB	4	24						

<sup>\*</sup> Box quantities provide enough fasteners to splice a 36" (900 mm) belt

Fastene	Fasteners Sets Required in a Complete Joint												
Belt \	Width	Fastener Size 1, 140, & 190			Fastener Size 1-1/2, 2 & 2-1/4			Fastener Size 2-1/2 & 3					
in.	mm	in.	mm	in.	mm	in.	mm	in.	mm	in.	mm	in.	mm
		9(	)°	4:	5°	91	)°	4	5°	9	)°	4!	5°
12	300	10	9	12	12	8	8	9	10	6	6	7	7
18	450	15	14	19	19	12	11	15	15	9	9	12	12
24	600	20	19	26	26	16	15	21	21	12	13	17	16
30	750	25	24	33	33	20	19	27	27	16	16	21	21
36	900	30	29	41	40	24	23	33	32	19	19	26	26
	1000		32		45		26		36		21		29
42	1050	35	34	48	47	28	27	39	38	22	21	31	30
48	1200	40	39	55	54	32	31	44	43	26	26	35	35
54	1350	45	44	63	61	36	35	48	49	29	29	40	40
60	1500	50	49	69	68	40	39	56	55	32	32	44	44
72	1800	61	59	83	82	48	49	68	65	39	39	53	53

NOTE: Required fastener sets may vary from those listed depending on exact fastener size

<sup>\*\* 10</sup> fastener sets

\*\* Packaged in cartons

NOTE: Additional fastener metal selections are available

### FLEXCO® BOLT SOLID PLATE


Fastening System

# **Installation Tools**

### 90° and 45° Templets

Templets are required for 90° and 45° Bolt Solid Plate fastener installation. Templets simplify installation by providing a guide for accurate bolt-hole placement. Lengths for all standard belt widths are available.

Ordering Information										
	elt dth	Ordering Number								
in.	mm	1	140	190	1-1/2	2	2-1/4	2-1/2	3	
	90° Templets									
12	300	1-12	140-12	190-12	1-1/2-12	2-12				
18	450	1-18	140-18	190-18	1-1/2-18	2-18				
24	600	1-24	140-24	190-24	1-1/2-24	2-24	2-1/4-24	2-1/2-24		
30	750	1-30	140-30	190-30	1-1/2-30	2-30	2-1/4-30	2-1/2-30		
36	900	1-36	140-36	190-36	1-1/2-36	2-36	2-1/4-36	2-1/2-36	3-36	
42	1050	1-42	140-42	190-42	1-1/2-42	2-42	2-1/4-42	2-1/2-42	3-42	
48	1200	1-48	140-48	190-48	1-1/2-48	2-48	2-1/4-48	2-1/2-48	3-48	
54	1350				1-1/2-54	2-54	2-1/4-54	2-1/2-54		
60	1500			190-60	1-1/2-60	2-60	2-1/4-60	2-1/2-60	3-60	
72	1800				1-1/2-72	2-72	2-1/4-72	2-1/2-72	3-72	
				45	° Templets					
12	300	1-12-45								
18	450	1-18-45		190-18-45	1-1/2-18-45					
24	600	1-24-45	140-24-45	190-24-45	1-1/2-24-45	2-24-45				
30	750	1-30-45	140-30-45	190-30-45	1-1/2-30-45	2-30-45				
36	900	1-36-45	140-36-45	190-36-45	1-1/2-36-45	2-36-45				
42	1050		140-42-45	190-42-45	1-1/2-42-45	2-42-45				
48	1200	1-48-45	140-48-45	190-48-45	1-1/2-48-45					
60	1500		140-60-45	190-60-45	1-1/2-60-45	2-60-45				

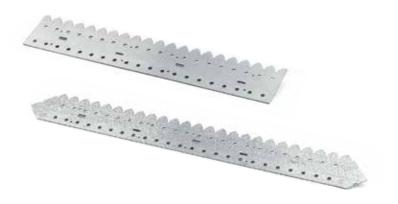

### **Rip Repair**

Use standard Flexco® Solid Plate fasteners to repair conveyor belt holes and edge tears. For jagged length-wise conveyor belt tears, standard Bolt Solid Plate fasteners can be combined with three-bolt Rip Repair fasteners. Three-bolt Rip Repair fasteners can also be used to bridge "soft" spots in the belt before they become rips.



Rip Repair Selection Information								
BeltTh	ickness	Fastener						
in.	mm	Size						
3/8-9/16	10-14	No. 16						
1/4-1/2	6-13	RP1						
3/8-13/16	10-21	RP2						
9/16-1-3/16	14-30	2-1/4						



Ordering Information									
Ordering Number	Box Qty.								
Steel									
RP1E	25								
RP1C	100								
RP2E	25								
RP2C	100								
2-1/4E	25								
2-1/4C	100								
Stainless									
RP1ES	25								
RP2ES	25								
2-1/4ES	25								
Everdur®									
2-1/4EE	25								
Turtle® Fastener–Steel									
16	50								





Hand installation tools



Power installation tools



Bolt Breaker



Flexco-Lok® Tape



Cracking Chisel

#### FLEXCO® BOLT SOLID PLATE

#### Fastening System

# Installation Tools and Supplies

The only tools needed for Bolt Solid Plate fastener installation are a templet and portable hand or power tools such as wrenches and belt punches. Impact wrench driven power tools are recommended and can reduce installation time by at least 50%.

### Flexco-Lok® Tape

Rigid nylon tape helps eliminate belt ripples on plied or solid-woven belting so belts run smoothly over pulleys and under cleaners. Also helps seal splices against seepage of fines and moisture.

#### **Cracking Chisel**

With a hammer and cracking chisel, individual worn plates can be easily replaced – without resorting to replacement of the entire splice.



Silicone Lubricant Spray

Ordering Information									
Description	Fastener Number	Ordering Number							
Hand Installation Tools									
Bolt Horn		2BH							
	1, 140, 190, RP1	P1P							
Punch	1-1/2, 2, 2-1/4, RP2	P2P							
	2-1/2, 3	P3P							
	1, 140, 190, RP1	B1B							
Boring Bit	1-1/2, 2, 2-1/4, RP2	B2B							
	2-1/2, 3	B3B							
	1, 140, 190, RP1	\$1\$**							
Wrench	1-1/2, 2, 2-1/4, RP2	S2S							
	2-1/2, 3	S3S							
Po	wer Installation Tools								
	1, 140, 190, RP1	HP1							
Power Punch	1-1/2, 2, 2-1/4, RP2	HP2							
	2-1/2, 3	HP3							
	1, 140, 190, RP1	HB1							
Power Boring Bit	1-1/2, 2, 2-1/4, RP2	HB2							
	2-1/2, 3	HB3							
	1, 140, 190, RP1	HW1**							
Power Wrench	1-1/2, 2, 2-1/4, RP2	HW2							
	2-1/2, 3	HW3							
Quick Change Chuck		5552							
	Bolt Breaker								
	1, 140, 190, RP1	110							
Bolt Breaker   (Two Per Package)	1-1/2, 2, 2-1/4, RP2	112*							
(g.,	2-1/2, 3	113*							
Flexco-I	_ok® Tape (100' per ca	irton)							
	1, 140	FL7C							
	190, 1-1/2, 2, 2-1/4	FL11C							
	Cracking Chisel								
	1, 140, 190	C1C							
	1-1/2, 2, 2-1/4	C2C							
	2-1/2, 3	C3C							
Flex	co® Silicone Lubrican	t							
Silicone Lubricant Spra	SL5-1								

<sup>\*</sup> Sizes 112 and 113 are straight bolt breakers—no bend

Authorized Distributor:





<sup>\*\*</sup> For use with slotted nuts only